



Multiflex[®] TES A6006 CWI1 NAT Thermoplastic Elastomer

FEATURES & BENEFITS

- UV stabilized
- Low compression set at 100°C
- Standard approvals : CSTB
- Natural color
- Compatibility: PP/PE

APPLICATIONS

- Multiflex[®] TES A6006 CWI1 NAT is designed for use in injection molding/extrusion

TYPICAL PROPERTIES

Specification Writers: These values are not intended for use in preparing specifications. Please contact your local Dow Corning sales office or your Global Dow Corning Connection before writing specifications on this product.

Test*	Property	Unit	Result
ISO 868	Hardness	Sh.A	60
ISO 1183/A	Density	g/cm ³	1.12
MDA 179	Spiral flow condition A	cm	67
ISO 37 Type 1 v = 500 mm/min	Tensile strength at 100% elongation cross direction	MPa	1.9
ISO 37 Type 1 v = 500 mm/min	Tensile strength at break cross direction	MPa	6.2
ISO 37 Type 1 v = 500 mm/min	Elongation at break cross direction	%	630
ISO 34	Tear strength cross direction	kN/m	30
MDA 129	Compression set 24h/23°C without annealing	%	15
MDA 129	Compression set 24h/70°C without annealing	%	26
MDA 129	Compression set 24h/100°C without annealing	%	41

*ISO: International Standardization Organization
MDA (Méthode d'Analyse): Issued from ISO Standards

GUIDELINES FOR INJECTION MOLDING

Drying: Multiflex[®] TES A6006 CWI1 NAT is not moisture sensitive, therefore drying is not needed. However, if this material is stored in high humidity conditions, it is recommended to dry for two hours at maximum 80°C.

Barrel temperature °C	Feed Zone	160 +/- 10
	Transition	190 +/- 10
	Front	200 +/- 10
	Nozzle	200 +/- 10
Melt temperature °C		210 +/- 10
Back Pressure Bars		10 +/- 5
Injection Speed		70 +/- 10% max
Holding Pressure		30 +/- 10% of Max Injection Pressure
Mold Temperature °C		40 +/- 20
Hot runner °C		190 +/- 10

GUIDELINES FOR EXTRUSION

Drying		Not needed
Barrel temperature °C	Feed Zone	160 +/- 10
	Zone 1	180 +/- 10
	Zone 2	190 +/- 10
	Adaptator/Die	200 +/- 10
Melt temperature °C		190 +/- 10

PROCESSING GUIDE

Multiflex[®] brand TES CW/T are styrenics thermoplastic elastomers, designed for high compression set applications. Compatibility with polyolefins enables bi-material parts (continuous process or cold insert).

Please find below some indications to follow to transform the product. This does not replace molder experience, every mold having its own specificity, but this document is useful for initial parameter choice.

Background

Multiflex[®] TES CW/T series can be transformed between 190°C to 230°C. In this temperature range, materials are stable, above, thermal degradation occurs, resulting in yellowing and significant odor emanation.

Pre-drying

As *Multiflex*[®] TES CW/T are not humidity sensitive, Pre-drying is not needed. In case of “incident”, pre-drying at 80–90°C during 1 to 2 hours is sufficient.

Machinery cleaning

High flow thermoplastic must be used, PEHD, PELD or PP.

Coloring

Multiflex[®] TES CW/T are easy colorable by using color masterbatch based on PP, PE or ethylene copolymers (EVA).

Recycling

Multiflex[®] TES CW/T are 100% recyclable without properties loss. We recommend a maximum level of 10% of recycling material in virgin material.

INJECTION

On a general point of view, viscosity of SEBS based material is principally dependent of applied shear, so *Multiflex*[®] TES CW/T must be injected with high injection speed. Due to their high fluidity, easy mold feeding for single or multiple cavities geometries are possible.

Processing parameters

Screw:

Geometry: standard injection machine, L/D > 20, compression rate 2:1 to 3:1 (if higher, risk of thermal degradation). Screw speed between 100 to 150 rpm ensures thorough melting of the material without excessive temperature generation. Start with 120 rpm.

Back pressure

Must be between 7 and 15 bars. This will ensure a uniform melt without severe shear heating.

Temperatures (°C)


See Figure 1.

- Feed Zone: 160 +/- 10
- Zone 1: 190 +/- 10
- Zone 2: 200 +/- 10
- Nozzle: 210 +/- 10

Injection speed

Injection speed and fill time are highly dependent on part geometry, complexity and gate design. Faster speeds typically result in easier mold filling while lower speeds result in better surface in better surface appearance. High injection speed, around 70% of maximum injection speed should be used initially.

Figure 1:

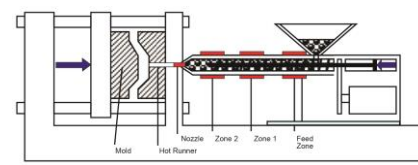

Holding pressure

Start with a pressure equivalent to 30% of maximum injection pressure. Excessive holding pressure can result in distortion in the area of the gate due to elastomeric characteristics of the material.

Holding time

Three seconds can be used to start to ensure sufficient time for gate freeze off. Holding time can be slowly reduced until changes in part appearance or weight occur.

Mold

Use conventional mold design (venting, finish, draft) with temperatures from 10 to 60°C, but typically chosen in the range of 40°C gives good results.

Hot Runners

Apply a temperature of 190°C +/- 10.

EXTRUSION


Multiflex[®] TES CW/T series can be processed on all extrusion machines for PVC, polyolefin. A screw, with a compression ratio of 3 is recommended.

Temperatures (°C)

See Figure 2.

- Feed Zone: 160 +/- 10
- Zone 1: 180 +/- 10
- Zone 2: 190 +/- 10
- Die: 200 +/- 10

Figure 2:

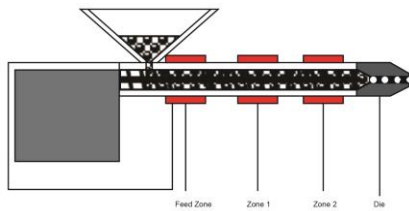

**HANDLING
PRECAUTIONS
PRODUCT SAFETY
INFORMATION REQUIRED FOR
SAFE USE IS NOT INCLUDED IN
THIS DOCUMENT. BEFORE
HANDLING, READ PRODUCT
AND SAFETY DATA SHEETS
AND CONTAINER LABELS FOR
SAFE USE, PHYSICAL AND
HEALTH HAZARD
INFORMATION. THE SAFETY
DATA SHEET IS AVAILABLE ON
THE DOW CORNING WEBSITE
AT DOWCORNING.COM, OR
FROM YOUR DOW CORNING
SALES APPLICATION
ENGINEER, OR DISTRIBUTOR,
OR BY CALLING
DOW CORNING CUSTOMER
SERVICE.**

**USABLE LIFE AND
STORAGE**

Refer to product label for storage temperature conditions. Containers should be kept tightly closed and kept in cold storage at all times to extend shelf life. Shelf life is indicated by the “Use Before” date found on the product label.

**PACKAGING
INFORMATION**

This product is available in a variety of container sizes. Contact your local Dow Corning sales representative for information about container sizes available in your area.

LIMITATIONS

This product is neither tested nor represented as suitable for medical or pharmaceutical uses.

**HEALTH AND
ENVIRONMENTAL
INFORMATION**

To support customers in their product safety needs, Dow Corning has an extensive Product Stewardship organization and a team of Product Safety and Regulatory Compliance (PS&RC) specialists available in each area.

For further information, please see our website, dowcorning.com or consult your local Dow Corning representative.

**LIMITED WARRANTY
INFORMATION – PLEASE
READ CAREFULLY**

The information contained herein is offered in good faith and is believed to be accurate. However, because conditions and methods of use of our products are beyond our control, this information should not be used in substitution for customer’s tests to ensure that our products are safe, effective, and fully satisfactory for the intended end use. Suggestions of use shall not be taken as inducements to infringe any patent.

Dow Corning’s sole warranty is that our products will meet the sales specifications in effect at the time of shipment.

Your exclusive remedy for breach of such warranty is limited to refund of purchase price or replacement of any product shown to be other than as warranted.

**TO THE FULLEST EXTENT
PERMITTED BY APPLICABLE
LAW, DOW CORNING
SPECIFICALLY DISCLAIMS
ANY OTHER EXPRESS OR
IMPLIED WARRANTY OF
FITNESS FOR A PARTICULAR
PURPOSE OR
MERCHANTABILITY.**

**DOW CORNING DISCLAIMS
LIABILITY FOR ANY
INCIDENTAL OR
CONSEQUENTIAL DAMAGES.**

We help you invent the future.™

dowcorning.com



Multibase is a subsidiary of The Dow Chemical Company.